

# Manhole Inspection Summary

Manhole # S39S\_\_044MH

Printed On: 2/12/2009

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39S** Node: **044** Status: **Found**

Insp Date: **10/17/08 11:45 AM**

Incomplete Comments

Crew: **cb**  
Inspector: **jjoiner**  
Firm: **ATS**

**Location** Address: **1414 key hw**

Cross Street: **webster st**

**Manhole** Type: **Inline** Location: **Other - See Comments**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **aaa loading dock**

**Cover** Shape: **Circular** Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Concrete** ☐ Parged Height: **4** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **3** Missing: **0** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S39S\_\_044MH

Printed On: 2/12/2009

Page 2 of 3

Location View



Top View



Defect 4




bench cond debris

Defect 3



channel cond debris

Defect 2

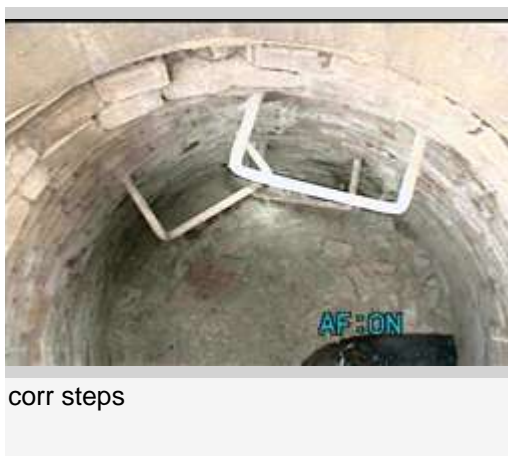

corr steps

Defect 1



chimney cond deteriorated

## Manhole Inspection Summary

Manhole # S39S\_\_044MH

Printed On: 2/12/2009

Page 3 of 3

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 7.66 (ft.) Flow Characteristics: Slow

Deposits: ☐ None ☐ Mud ☒ Sludge ☒ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None

Pipe Seal Cond: Unknown

Drop: None

Connects To: Connecting Node Not Available

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 7.37 (ft.) Flow Characteristics: Slow

Deposits: ☐ None ☐ Mud ☒ Sludge ☒ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None

Pipe Seal Cond: Unknown

Drop: None

Connects To: House connection / Service line

☐ Possible Illicit Connection